MIDMARK®

# Installation Instructions

## 002-0239-00 RESET BUTTON KIT FOR M7 STERILIZER

### KIT COMPONENTS

| Part Number | Description | Qty. |
|---|---|---|
| 057-0520-00 | Reset Rod | 1 |
| 053-1035-00 | Reset Button | 1 |
| 003-0942-00 | Installation Instructions | 1 |

### REQUIRED TOOLS

Drill Bit (1/8")
Power hand drill
Phillips Screwdriver
Locking Pliers or vise

### 1

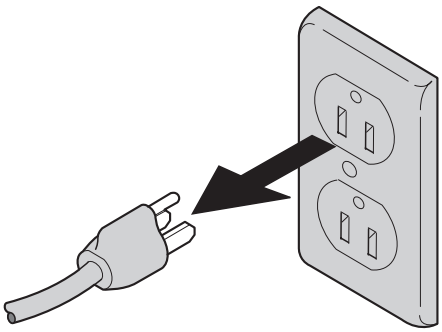

MA42000a

**DANGER**

**Unplug sterilizer from electrical outlet. Allow unit to cool before performing service functions. Failure to comply may result in personal injury and/or death.**

**NOTE**

This Reset Button Kit is used on earlier M7 Sterilizers with the following serial numbers:

CP1000-1091 CR1000-CR1259 CS1000-3488
RB1000-11004 DR1000-1014

### 2

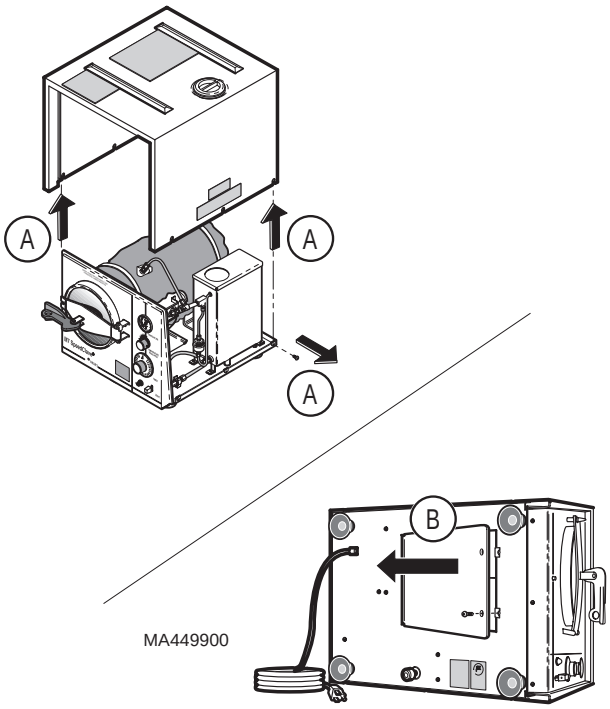


**A.** Drain water from unit and remove cover.
**B.** Lay unit on side and remove inspection cover.

### 3

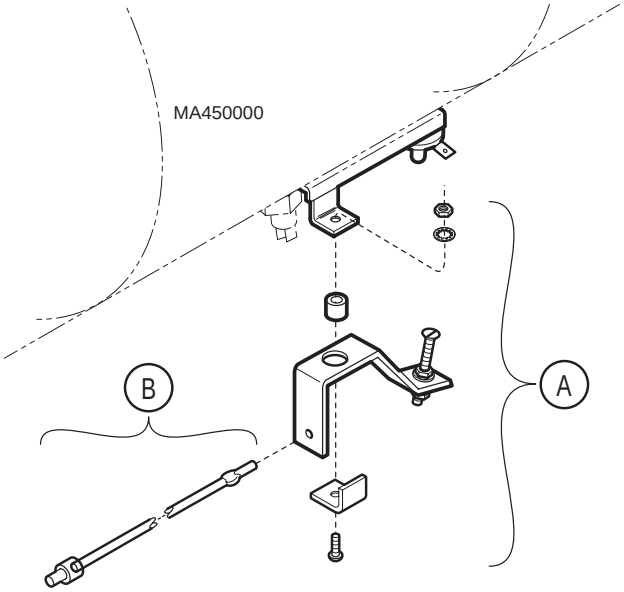


**A.** Remove mounting screw, washer, nut, rocker bracket, spacer and L-shaped bracket.
**B.** Remove old rod and reset button.

© Midmark Corporation - 1998

## 4

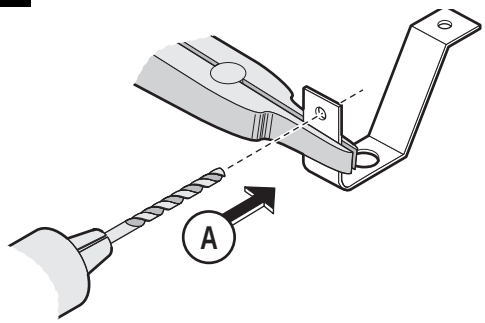


MA450100

### CAUTION

Place rocker bracket in a locking pliers or vise when drilling. Failure to comply could result in personal injury.

**A.** Secure rocker bracket then; enlarge rod hole using 1/8" drill bit.

## 5

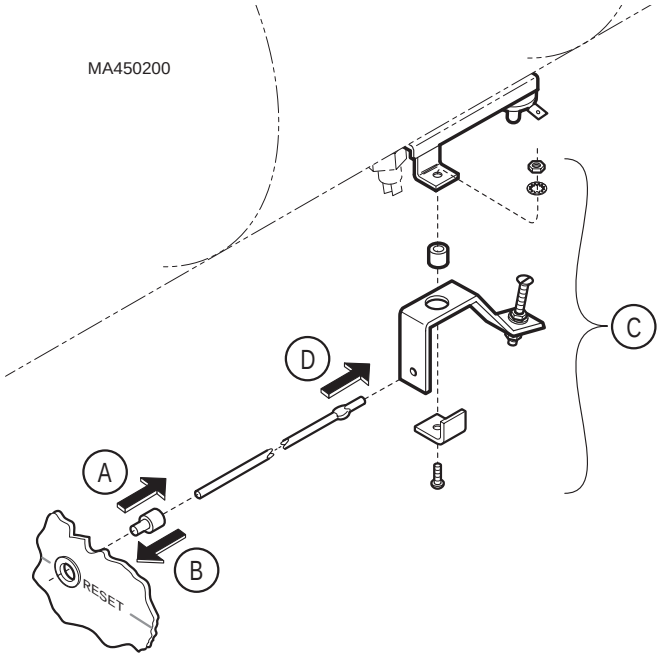


### NOTE

Reset button is positioned on opposite end from crimped end of reset rod.

**A.** Install reset button on reset rod.

**B.** Insert button end of rod into reset button guide.

**C.** Install L-shaped bracket, rocker bracket and spacer then *loosely* install screw, lockwasher and nut.

**D.** Insert end of reset rod into hole of rocker bracket and then; tighten screw, lockwasher, nut then; install inspection cover.

## 6

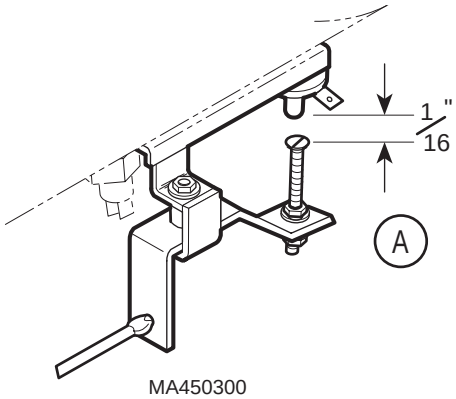


MA450300

### EQUIPMENT ALERT

Distance between head of adjustment screw and reset button on overload thermostat must be approximately 1/16" with reset button ,on front of cabinet, not being depressed. Failure to comply may result in overload not operating correctly causing equipment failure.

**A.** Place unit in upright position and check distance between head of adjustment screw and reset button on temperature overload protector. If necessary, readjust screw.

## 7

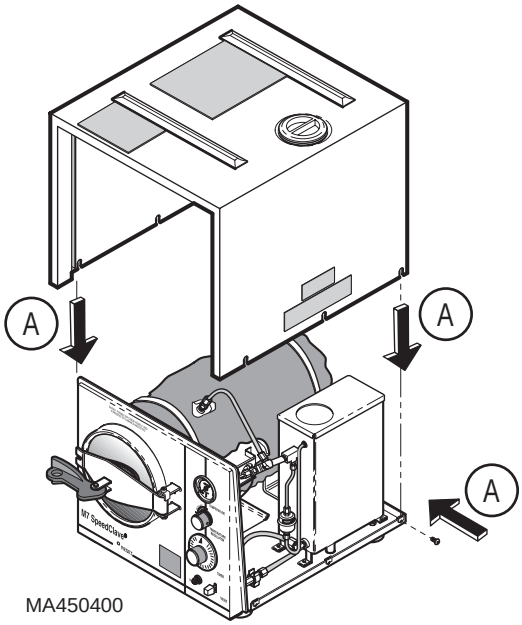


MA450400

### EQUIPMENT ALERT

Operate unit to assure overload thermostat operates correctly.

**A.** Place water in reservoir, install cover, plug unit into wall outlet and check operation.

MIDMARK®

Midmark Corporation, Versailles, Ohio 45380 U.S.A.
(937) 526-3662 FAX (937) 526-5542

003-0942-00 Rev. C (9/99)

© Midmark Corporation - 1998